

The following playfield changes have been made to ROLLER GAMES 59. Keep this Addendum with your ROLLER GAMES 59 Operations Manual.


REMOVED FROM PLAYFIELD:

- C-13457 5 BANK DROP TARGET ASSEMBLY (Quantity 1) Section 2, page 74 Item 9 and Individual Pictorial Diagram
- 03-8247-13 Post (Quantity 5) Section 2, page 67
- A-13508 Rollover Switch (Quantity 1) Section 2, Unique Parts List
- 23-6308 Rubber Rings (Quantity 2) Section 2, page 69

REPLACED WITH:

- B-11696-1 STANDUP TARGET ASSEMBLY (Quantity 5)
- 03-8319-9 Post (Quantity 1)
- A-12688 Rollover Switch (Quantity 1)
- Note: Rubber Rings were not replaced.

STANDUP TARGET ASSEMBLY
B-11696-1

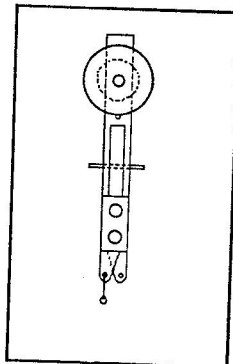

ROLLER GAMES 59

The following changes have been made to ROLLER GAMES 59. Keep this Addendum with your ROLLER GAMES 59 Operations Manual.

PLAYFIELD CHANGES

REMOVED FROM PLAYFIELD:

- C-13457 5 BANK DROP TARGET ASSEMBLY (Quantity 1) Section 2, page 74 Item 9 and Individual Pictorial Diagram
- 03-8247-13 Post (Quantity 5) Section 2, page 67
- A-13508 Rollover Switch (Quantity 1) Section 2, Unique Parts List
- 23-6308 Rubber Rings (Quantity 2) Section 2, page 69
- A-8798 Flashlamp (Quantity 1, Flash 8) Section 2, Solenoid Diagram

REPLACED WITH:

- B-11696-1 STANDUP TARGET ASSEMBLY (Quantity 5)
- 03-8319-9 Post (Quantity 1)
- A-12688 Rollover Switch (Quantity 1)
- Note: Rubber Rings and the Flashlamp were not replaced.

INSERT PANEL CHANGES

REMOVED FROM INSERT PANEL:

- H-13547 Cable (Quantity 1)
- A-8798 Flashlamps (Quantity 15) All Flashlamps

REPLACED WITH:

- H-13547-1 Cable (Quantity 1) Replaces H-13547
- Note: Flashlamps were not replaced.

5-11-90
10-389-1 spring } need for diverter
AE-26-1200 coil } assy. coil AE-23-800 is
strong that's why spring
is breaking!