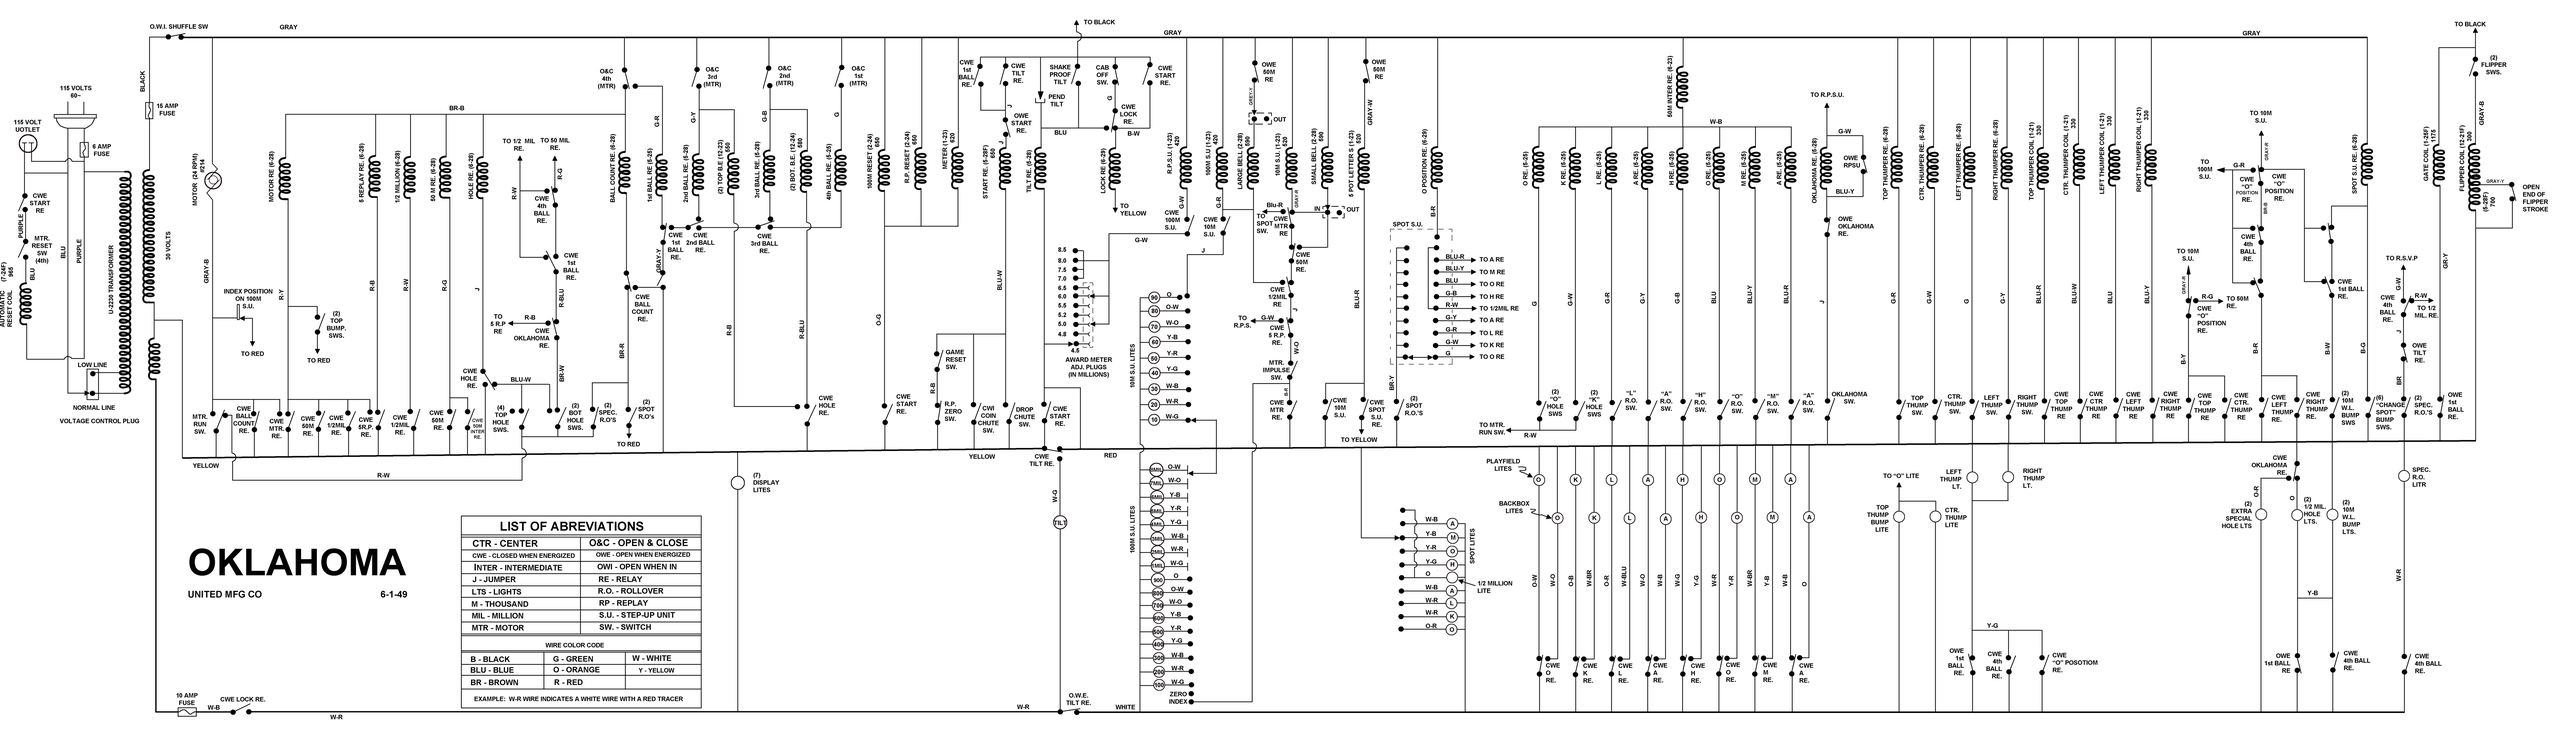
OKLAHOMA
UNITED MFG CO
6-1-49
LIST OF ABREVIATIONS
CTR - CENTER
O&C - OPEN & CLOSE
CWE - CLOSED WHEN ENERGIZED
OWE - OPEN WHEN ENERGIZED
INTER - INTERMEDIATE
OWI - OPEN WHEN IN
J - JUMPER
RE - RELAY
LTS - LIGHTS
R.O. - ROLLOVER
M - THOUSAND
RP - REPLAY
MIL - MILLION
S.U. - STEP-UP UNIT
MTR - MOTOR
SW. - SWITCH
WIRE COLOR CODE
B - BLACK
G - GREEN
W - WHITE
BLU - BLUE
O - ORANGE
Y - YELLOW
BR - BROWN
R - RED
EXAMPLE: W-R WIRE INDICATES A WHITE WIRE WITH A RED TRACER
115 VOLTS 60~
115 VOLT UOTLET
6 AMP FUSE
CWE START RE
MTR. RESET SW (40¢)
LOW LINE
NORMAL LINE
VOLTAGE CONTROL PLUG
U-223V TRANSFORMER
30 VOLTS
O.W.I. SHUFFLE SW
15 AMP FUSE
MOTOR (24 RPM) 4214
INDEX POSITION ON 100M (1 S.U.
TO RED
(2) TOP BUMP. SWS.
MTR. RUN SW.
CWE BALL COUNT/ RE.
CWE MTR RE.
CWE 66M RE.
CWE 1/2MIL RE.
CWE 5K.P. RE.
CWE 1/2MIL RE.
CWE 66M RE.
CWE HOLE RE.
CWE 66M RETURN RE.
(4) TOP HOLE SWS.
(2) BOT HOLE SWS.
(2) SPEC. R.O'S
(2) SPOT R.O's
MOTOR RE (6-28)
6 REPLAY RE. (6-28)
1/2 MILLION (6-28)
66 M RE. (6-28)
HOLE RE. (6-28)
TO 1/2 MIL RE.
TO 50 MIL RE.
CWE 4th BALL RE.
CWE 1st BALL RE.
TO 5 R.P RE
CWE OKLAHOMA RE.
CWE HOLE RE.
BALL COUNT RE. (6-28)
1st BALL RE (6-24)
2nd BALL RE. (6-28)
3rd BALL RE. (6-28)
4th BALL RE. (6-28)
CWE 1st BALL RE.
CWE 2nd BALL RE.
CWE 3rd BALL RE.
CWE BALL COUNT RE.
CWE HOLE RE.
O&C 4th (MTR)
O&C 3rd (MTR)
O&C 2nd (MTR)
O&C 1st (MTR)
(2) TOP B.E. (10-23)
(2) BOT. B.E. (12-24)
1000 RESET (7-24)
R.P. RESET (2-24)
METER (1-23)
START RE. (6-28)
TILT RE. (6-28)
CWE START RE.
GAME RESET SW.
R.P. ZERO SW.
CWE COIN CHUTE SW.
DROP CHUTE SW.
CWE START RE.
CWE TILT RE.
(7) DISPLAY LITES
CWE 1st BALL RE.
CWE TILT RE.
SHAKE PROOF TILT
CAB OFF SW.
PEND TILT
CWE LOCK RE.
CWE START RE.
LOCK RE (6-28)
TO YELLOW
R.P.S.U. (1-23)
1000 S.U (1-23)
LARGE BELL (2-28)
1000 S.U. (1-23)
SMALL BELL (2-28)
4 SPOT LETTER S (1-23)
AWARD METER ADJ. PLUGS (IN MILLIONS)
1000 S.U. LITES
CWE 100M S.U.
CWE 66M RE.
CWE 1/2MIL RE
CWE 5 R.P. RE.
CWE MTR RE.
MTR. IMPULSE SW.
CWE 10M S.U.
CWE SPOT S.U. RE.
TO R.P.S.
TO SPOT MTR SW.
CWE SPOT MTR RE
TO A RE
TO M RE
TO O RE
TO H RE
TO 1/2MIL RE
TO A RE
TO L RE
TO K RE
TO O RE
(2) SPOT R.O.'S
SPOT S.U.
66M INTER RE. (6-23)
O RE. (6-28)
K RE. (6-28)
I RE. (6-28)
A RE. (6-28)
H RE. (6-28)
O RE. (6-28)
M RE. (6-28)
A RE. (6-28)
O POSITION RE. (6-29)
(2) "O" HOLE SWS
(2) "A" HOLE SWS
"L" R.O. SW.
"A" R.O. SW.
"H" R.O. SW.
"O" R.O. SW.
"M" R.O. SW.
"A" R.O. SW.
OKLAHOMA SW.
TO MTR. RUN SW.
TO R.P.S.U.
OWE RPSU
OKLAHOMA RE. (6-28)
OWE OKLAHOMA RE.
TOP THUMPER RE. (6-28)
CTR. THUMPER RE. (6-28)
LEFT THUMPER RE. (6-28)
RIGHT THUMPER RE. (6-28)
TOP THUMPER COIL (1-21) 330
CTR. THUMPER COIL (1-21) 330
LEFT THUMPER COIL (1-21) 330
RIGHT THUMPER COIL (1-21) 330
TOP THUMP SW.
CTR. THUMP SW.
LEFT THUMP SW.
RIGHT THUMP SW.
CWE THUMP RE
CWE CTR. THUMP RE
CWE LEFT THUMP RE
CWE RIGHT THUMP RE
TO 100M S.U.
TO 10M S.U.
CWE "O" POSITION RE.
CWE 4th BALL RE.
TO 50 M RE.
TO 1/2 MIL. RE.
OWE TILT RE.
SPOT S.U. RE. (6-28)
GATE COIL (1-13SF) 1170
FLIPPER COIL (12-23T) 1700
(2) FLIPPER SWS.
OPEN END OF FLIPPER STROKE
CWE 1st BALL RE.
(2) 10M W.L. BUMP SWS
(6) "CHANGE" SPOT" BUMP SWS.
(2) SPEC. R.O.'S
SPEC. R.O. LITR
OWE 1st BALL RE.
CWE 4th BALL RE.
PLAYFIELD LITES
BACKBOX LITES
SPOT LITES
1/2 MILLION LITE
TOP THUMP BUMP LITE
LEFT THUMP LT.
RIGHT THUMP LT.
CTR. THUMP LITE
(2) EXTRA SPECIAL HOLE LTS
(2) 1/2 MIL HOLE LTS.
(2) 10M W.L. BUMP LTS.
10 AMP FUSE
CWE LOCK RE.
O.W.E. TILT RE.
TO BLACK
TO "O" LITE